D C I Digital Cinema Initiatives, LLC

REVISION TO DCI DIGITAL CINEMA SYSTEM SPECIFICATION COMPLIANCE TEST PLAN, VERSION 1.2

CTP Revision items continue to be evaluated and will be posted after agreement by the DCI membership that the specific CTP Revision needs to modify the DCI Digital Cinema System Specification, Compliance Test Plan, Version 1.2. Suggested CTP Revision issues may be emailed to dci.info@dcimovies.com. Please include "CTP Revision" in the subject line.

DCI DCSS CTP v1.2 REVISION

16 July 2020

Revision Date	Revision Stage Type	CTP v1.2 Page No.	Sections Affected	Problem Description	Revision Description
July 16, 2020	1	284	7.2.1	The requirements for type 2 SPB Security Servicing openings have been changed to allow standard locks and tamper-evident seals as an alternative to pick resistant locks.	Replace procedure test number 2 as shown below.

Current Section 7.2.1. Type 2 Physical Protection, Procedures, item 2.:

By physical examination and using documentation provided by the manufacturer:

2. Locate, and for each of any removable access covers and/or doors of the type 2 SPB intended for Security Servicing (i.e., openings that enable access to Security-Sensitive Signals), record whether they are protected by pick resistant mechanical locks employing physical or logical keys.

The absence of protection as required on any of these security access covers or doors is cause to fail this test.

Revised Section 7.2.1. Type 2 Physical Protection, Procedures, item 2.:

By physical examination and using documentation provided by the manufacturer:

 Locate, and for each of any removable access covers and/or doors of the type 2 SPB intended for Security Servicing (i.e., openings that enable access to Security-Sensitive Signals), record whether they are protected by either (1) mechanical locks employing physical or logical keys and tamperevident seals (e.g., evidence tape or holographic seals), or (2) pick resistant locks employing physical or logical keys.

The absence of protection as required on any of these security access covers or doors is cause to fail this test.